

**SAS Superstructure**

Location: 04-SF-80-13.2 / 13.9

Client Name: CalTrans

Run date 22-Nov-14

Time 9:17 AM

Daily Diary Report by Bid Item

Contract No.: 04-0120F4

Diary #: 360 Const Calendar Day: 835 Date: 17-Sep-2014 Wednesday

Inspector Name: Liu, Tai-Lin Title: Transportation Engineer

Inspection Type: Continuous

Shift Hours: 07:00 AM 03:30 PM Break: 00:30 Over Time:

Federal ID:

Location:

Reviewer: Awal, Mohammad Approved Date: Status: Submit

**04-0120F4
04-SF-80-13.2/13.9
Self-Anchored
Suspension Bridge****Weather**

Temperature 7 AM 60 - 70 12 PM 70 - 80 4PM 70 - 80

Precipitation Condition Clear

Working Day ☒ If no, explain:**Diary:**

Dispute

Tower Activities

CCO # 382 - Tower Painting and Cleaning works (9/17/14, Wednesday - light wet & wind):



* I had truck accident on 09/11. Did not come to tower until today.

* Talked to Awal obtaining latest tower status and studied the paint repair tracking sheet. Went to job site (T1 by driving to W2) and walked to tower deck area El. 53m.

- Saw METS paint inspector Stuart and paint QC Sage with several painters on tower El. 53 m area. Painters performed paint repair on ladder, ladder cage and floor area in various elevation. Due to light rain this early morning, I asked Stuart about paint condition, he told me that OK to perform painting now (1:15 PM). Tower elevator already shut down, Sage said that they can start clearing the area on face D elevator railing area on both N-W shafts by using spider. Total 6 painters on the site will work 10 hours today.

- Six CCC's painters performed paint repair on ladder & ladder cage from EL. 143 - 145 m, El. 119 down to 53E and el. 89/53 unistrut area as well. METS Stuart did inspect ladder & cage paint area from El.65 to 119 area. Sage told me that they started working down from el.53 to the tower base.

* Paint Crew: Sage Ray, Juan Carlos, Luis Ventura, Oscar Salazar, Ramon Gutierrez, Abraham Ventura. Crew worked from 6AM to 4:30 PM, 10 hours shift.

* Labores: James Sturgeon (10 hours), Victor Hernandez, Jose Avila Jr. and Danny Schwartz (8 hours) worked today.

- Left T1 around 2:30PM,

* Performed paper work (spreadsheet for calculating footing concrete crack repair length) at office, and left office around 3:20 PM.

04-0120F4 Bid Item: 053 T-L01-DSE.053 Tower Lift 01 Diaphragm Tower SE Erect structural steel (bridge tower)

AMERICAN BRIDGE/FLUOR, A JV

Labor

Trade	Class	Name	RT Hrs	OT Hrs	DT Hrs	Total	Remarks	Dispute
Contractor: AMERICAN BRIDGE/FLUOR, A JV								
Ironworker	JNM	DONALD PLUMB	0.00	0.00	0.00	0.00		<input type="checkbox"/>
Ironworker	JNM	PAUL FAMBRINI	0.00	0.00	0.00	0.00		<input type="checkbox"/>



Daily Diary Report by Bid Item

Job Name: 04-0120F4 **Inspector Name** Liu, Tai-Lin **Diary #:** 360 **Date:** 17-Sep-2014 **Wednesday**

Semi-Skilled Laborer	JNM	FERMIN MEDINA	0.00	0.00	0.00	0.00		<input type="checkbox"/>
Ironworker	GEN	AARON KENT	0.00	0.00	0.00	0.00		<input type="checkbox"/>
Semi-Skilled Laborer	JNM	LUIS Jimenez	0.00	0.00	0.00	0.00		<input type="checkbox"/>
Semi-Skilled Laborer	JNM	DANNY SCHWARTZ	0.00	0.00	0.00	0.00		<input type="checkbox"/>
Semi-Skilled Laborer	APP	JAVIER MEDINA	0.00	0.00	0.00	0.00		<input type="checkbox"/>
Semi-Skilled Laborer	FOR	GUILLERMO LIMON	0.00	0.00	0.00	0.00		<input type="checkbox"/>
Semi-Skilled Laborer	APP	ROGELIO RODRIGUEZ	0.00	0.00	0.00	0.00		<input type="checkbox"/>
Semi-Skilled Laborer	JNM	CARLOS MONTEJANO	0.00	0.00	0.00	0.00		<input type="checkbox"/>
Semi-Skilled Laborer	APP	JOSE AVILA	0.00	0.00	0.00	0.00		<input type="checkbox"/>
Semi-Skilled Laborer	JNM	VICTOR HERNANDEZ	0.00	0.00	0.00	0.00		<input type="checkbox"/>
Ironworker	FOR	JAMES STURGEON	0.00	0.00	0.00	0.00		<input type="checkbox"/>
Equipment							Rental Company	
Equipment ID	Description		RT Hrs	OT Hrs	ST Hrs	IT Hrs	Remarks	Dispute
Contractor:	AMERICAN BRIDGE/FLUOR, A JV							
*E0020562	WELDING EQUIPMENT						No	
			0.00	0.00	0.00	0.00		<input type="checkbox"/>
*E0030562	WELDING EQUIPMENT						No	
			0.00	0.00	0.00	0.00		<input type="checkbox"/>
*E0010562	WELDING EQUIPMENT						No	
			0.00	0.00	0.00	0.00		<input type="checkbox"/>
2292	WELDER, 600 AMP						No	
			0.00	0.00	0.00	0.00		<input type="checkbox"/>
2293	WELDER, 600 AMP						No	
			0.00	0.00	0.00	0.00		<input type="checkbox"/>
04-0120F4	Bid Item:	078	T-L01-ENE.078	Tower Lift 01 External Paint Tower NE				
CERTIFIED COATINGS COMPANY								
04-0120F4	Bid Item:	078	T-L05-ENE.078	Tower Lift 05 External Paint Tower NE				
CERTIFIED COATINGS COMPANY								
04-0120F4	Bid Item:	078	T-HEA-ENE.078	Tower Head External Paint Tower NE				
CERTIFIED COATINGS COMPANY								
CCO-355	Bid Item:	001	0-CIC-EFA.355	CIC - Elevator Impacts - USA Hoist				
AMERICAN BRIDGE/FLUOR, A JV								

Attachment



Daily Diary Report by Bid Item

Job Name: 04-0120F4

Inspector Name Liu, Tai-Lin

Diary #: 360

Date: 17-Sep-2014


Wednesday



Stuart & CCC want to know who are going to perform water tank (@ El.53m area) paint repair



Paint repair on ladder cage

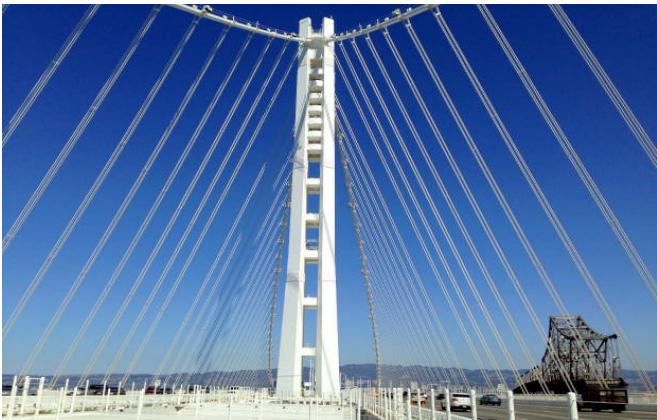

Tower view from W2 area



ABF labor forman James, paint QC Sage & METS's paint inspection on El.53 area



Saw seeral painters on El. 53 area performing floor paint repair



James & Sage cut the PVC pipes obtained from tower

Daily Diary Report by Bid Item

Job Name: 04-0120F4

Inspector Name Liu, Tai-Lin

Diary #: 360

Date: 17-Sep-2014

Wednesday



painter performed ladder paint repair at El. 48m area



One painter performed ladder cage paint repair at El. 57 m



One painter went down to El. 47 m area to perform floor paint repair